


Frame 3 Pneumatic Winch

Parts Breakdown

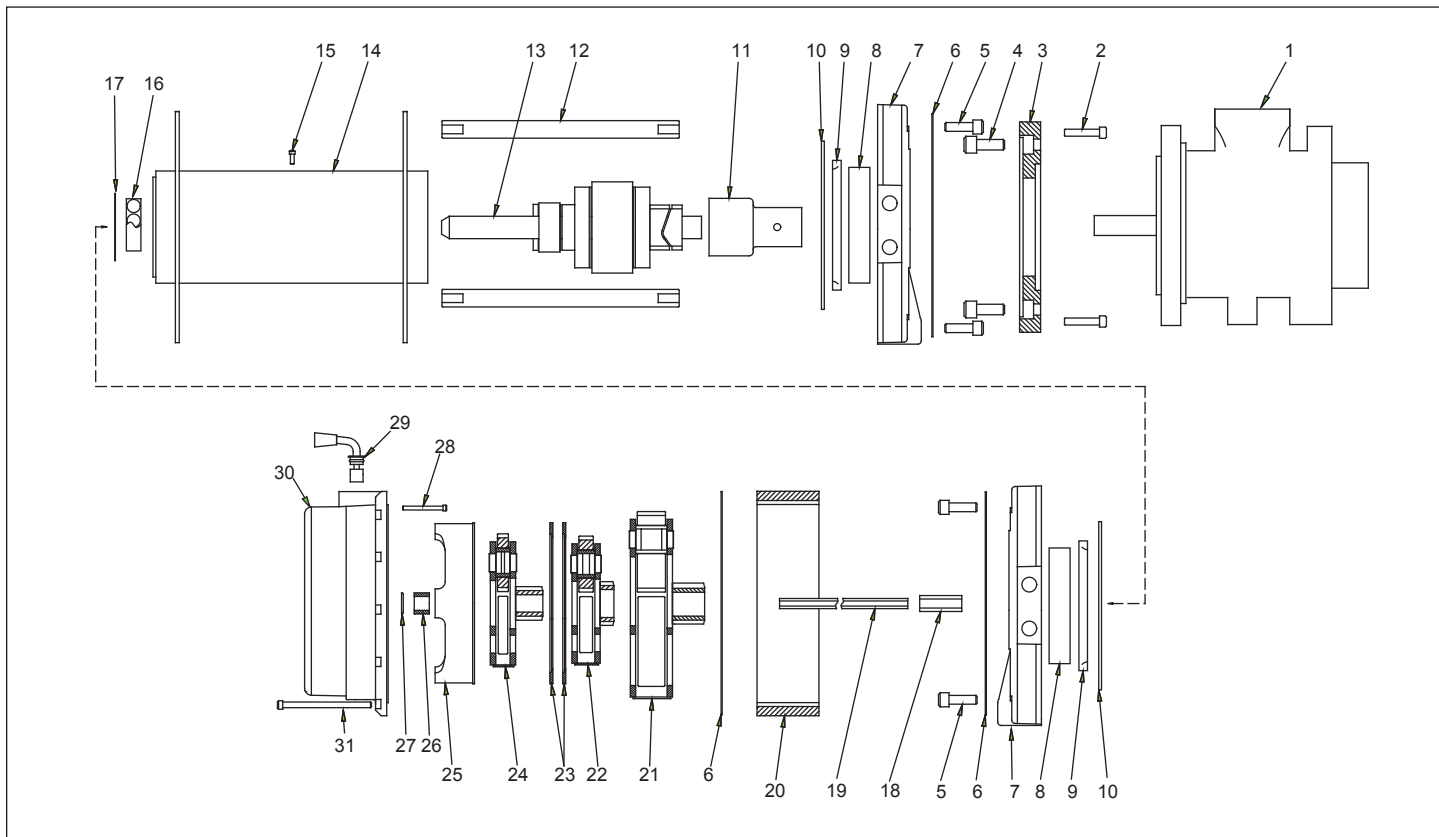

Parts List

WG10000-P-02

Item	Part Number	Qty.	Description	Item	Part Number	Qty.	Description
1	VA8CXXX10	1	Pneumatic Motor	21	30335	1	3rd Stage Carrier
2	-----	10	1/4-20 x 1-1/4" SHCS	22	24563	1	2nd Stage Carrier
3	MC1065	1	Motor Adapter	23	15581	2	Retaining Ring
4	-----	4	3/8-16 x 3/4" SHCS	24	15643	1	1st Stage Carrier
5	-----	6	3/8-16 x 1-1/4" SHCS	25	34837	1	Clutch Gear
6	14964	3	Gasket	26	24832	1	Sun Gear
7	31675	2	Drum Support	--	64252	1	Thrust Plug
8	30274	2	Drum Bushing	28	16086	1	Clutch Retainer
9	30275	2	Seal	29	39928	1	Freespool Lever
10	30277	2	Thrust Washer	30	31684	1	Gear Housing Assembly
11	MC1017	1	Coupler	31	-----	10	1/4-20 x 3" SHCS
12	30268	3	Tie Rod				
13	31683	1	Drum Brake				
14	31671	1	Drum				
15	36974	1	Set Screw				
16	31672	1	Bearing/Tolerance Ring				
17	3000-X187	1	Snap Ring				
18	30329	1	Drive Shaft Adapter				
19	30315	1	Drive Shaft				
20	31679	1	Ring Gear				